



HYUNDAI Nexo

Nexo

VIN NO KMHJ8816FLU006392
Registration Number 6FLU006392



MOT Date	Number of Owners	Number of Keys	Odometer Reading
-	2	1	47693 km
Last Service	Last Service Mileage	First Registration Date	Country First Registered
2024-09-27	42590	2020-07-09	-

Inspection Report Summary

Customer	BCA Online	Report Number	P20250512093550
Inspection Date / Place	2025-05-12 / BCA Oberndorf	Cosmetic Grade	2


Vehicle Summary



Vehicle Condition	Runner	VAT Type	Margin
Fuel Type	Hydrogen	Road Worthy	Yes
Colour	Cream	Engine Size (cc)	
Engine Size		No of Doors	5
Body Type	SUV	Drive Train	Front
Seat Colour		No of Seats	5
Seat Covering Name	Grey Two tone	Seat Covering	Cloth/Synthetic Leather
Charging Cables		WLTP CO2 Emissions	
Gearbox Type	Automatic		

Vehicle History & Documents

Service Book Available	Present	Next Service Mileage	km
Previous Usage		Imported	No
Manufacturer Warrenty			



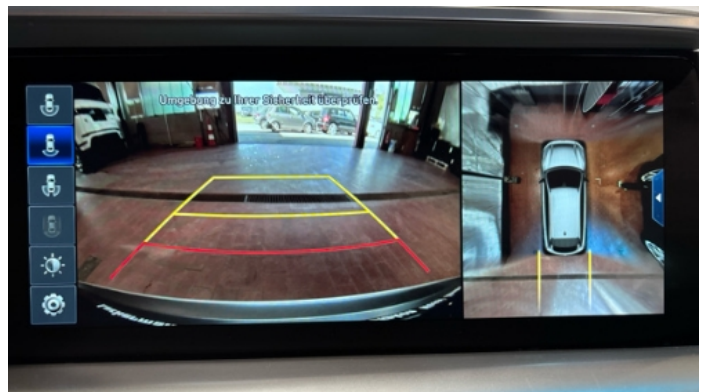

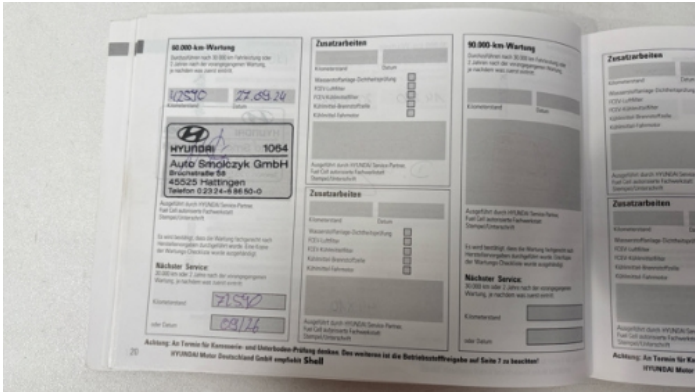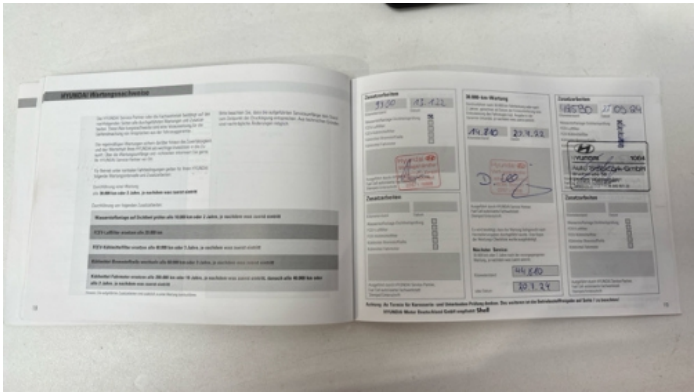

Equipment

Tow ball	360°camera	Alloys wheels	Bluetooth telephone interface
Digital Radio	Front parking sensors	Remote central locking	Satellite navigation
Split folding rear seats	Sunroof	Electrically folding wing mirrors	Leather steering wheel
Radio	USB Socket	Airbag Status	Anti-lock braking
Cruise control	Digitaldashboard	Remote adjusting wing mirrors	Roof rails
Seatventilation	Stability control	Electrically adjustable seats	Electrictailgate
LED Headlamps	Rear parking sensors		

Equipment Details


Tow Ball Type	Detachable	Air Conditioning	Dual Zone Climate Control
Alloy Wheel Size	19	Extra Wheel / Tyre Set	Winter Tyres - Alloy
Seat Heating	Front and Rear	Sunroof Type	Tilt/Slide Glass

Wheels & Tyres


Right Front Tyre Depth	7	Left Front Tyre Depth	7
Right Rear Tyre Depth	7	Left Rear Tyre Depth	7
Extra Wheel - 1 Tyre Depth	6	Extra Wheel - 2 Tyre Depth	6
Extra Wheel - 3 Tyre Depth	6	Extra Wheel - 4 Tyre Depth	6

Cosmetic Damage

9 Schäden

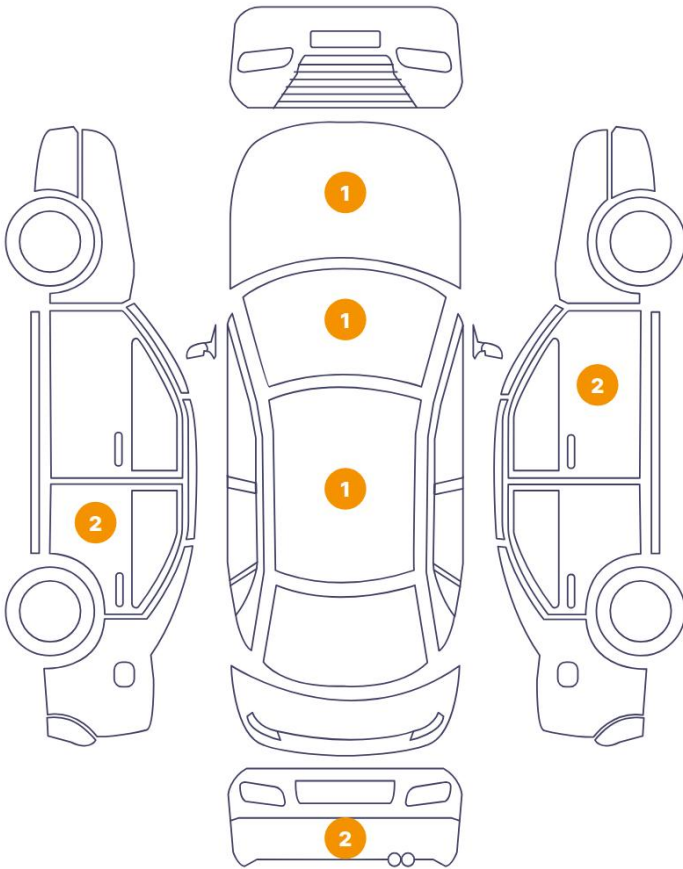

6 Schäden

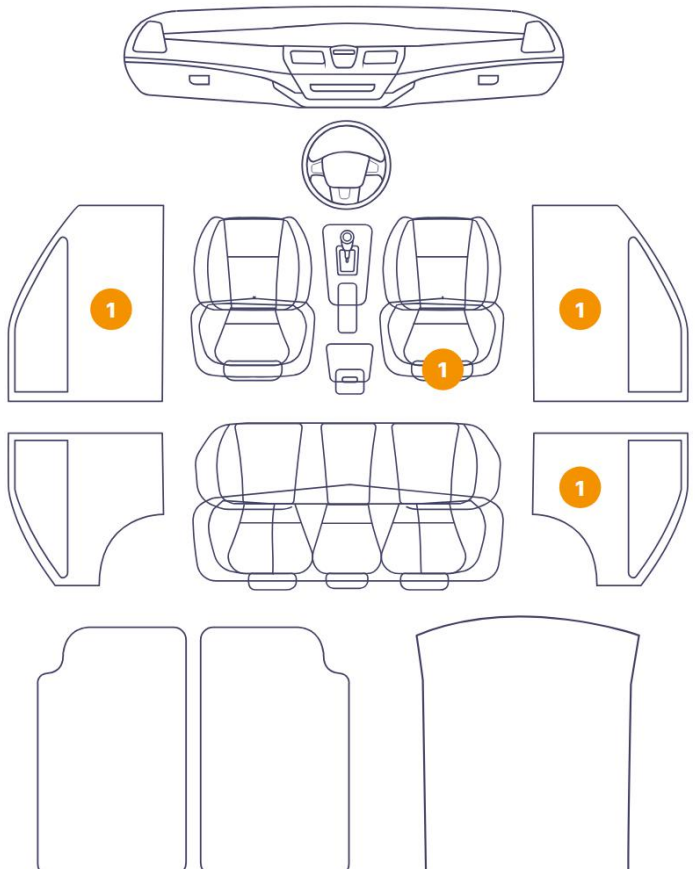

Component		Damage	Comments
1	Luggage Space Cover / Back	Interior / Scraped	
2	Tailgate Upholstery / Back	Interior / Scraped	
3	Windshield / Front	Glass Break / Impact	
4	Panel Filling / Front Left	Interior / Scraped	
5	Pillar / Back Left	Paint / Scratch / Line	
6	Roof	Bodywork / Dent / Hail Area	
7	Hood	Bodywork / Dent / Hail Area	
8	Panel Filling / Front Right	Interior / Scraped	
9	Backrest Cover / Front Right	Interior / Scraped	
10	Door / Front Right	Bodywork / Dent / Dent	
11	Door / Front Right	Bodywork / Dent / Dent	
12	Bumper / Back	Paint / Scratch / Scuff	
13	Bumper / Back	Paint / Scratch / Scuff	


14	Door / Back Left	Paint / Scratch / Scuff
15	Interior door handle Back right	Interior / Scraped




1. Luggage Space Cover / Back Interior / Scraped -



2. Tailgate Upholstery / Back Interior / Scraped -

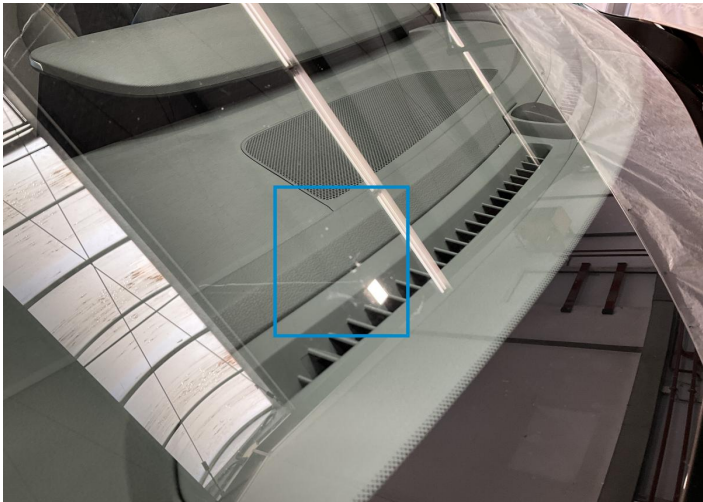

3. Windshield / Front Glass Break / Impact -

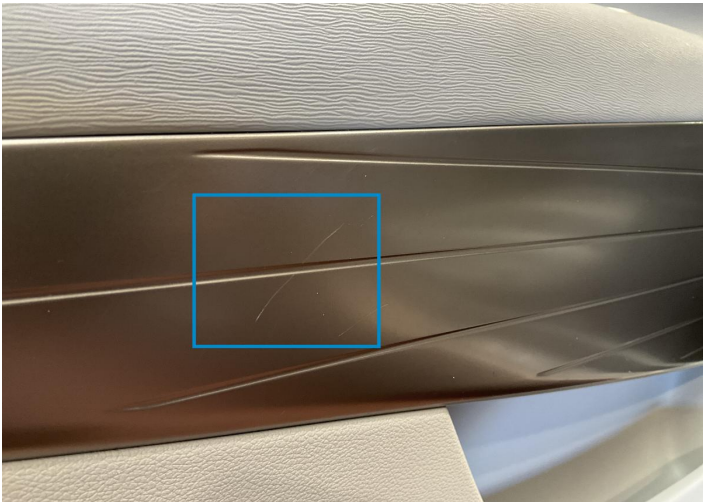


4. Panel Filling / Front Left Interior / Scraped -



5. Pillar / Back Left Paint / Scratch / Line -



6. Roof Bodywork / Dent / Hail Area -

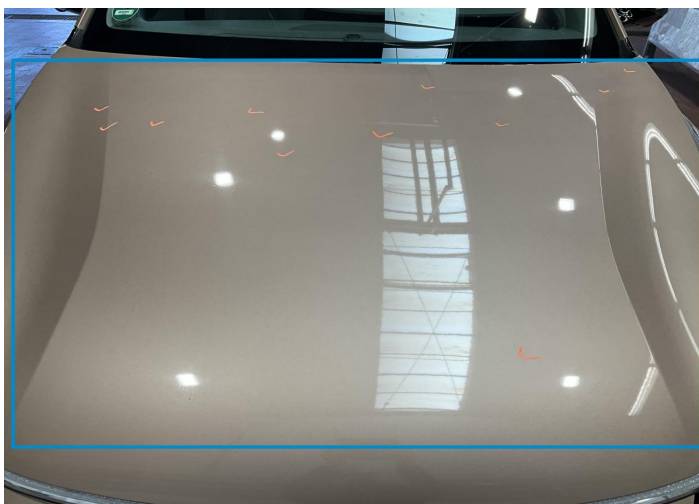


7. Hood
Bodywork / Dent / Hail Area -




8. Panel Filling / Front Right
Interior / Scraped -



9. Backrest Cover / Front Right
Interior / Scraped -

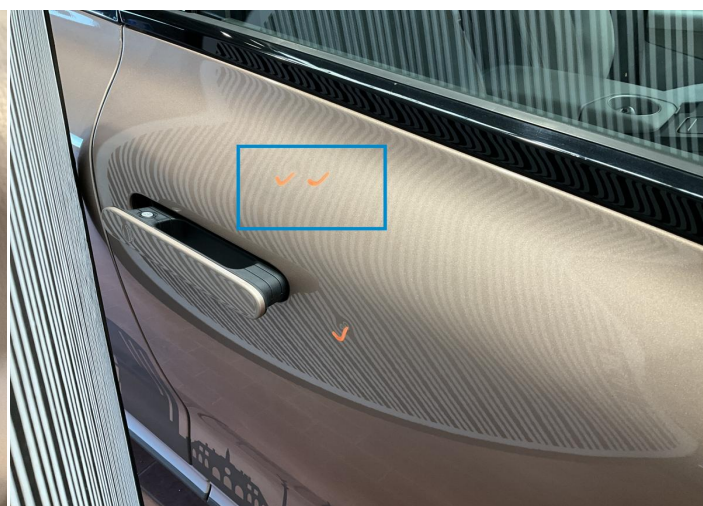


10. Door / Front Right
Bodywork / Dent / Dent -

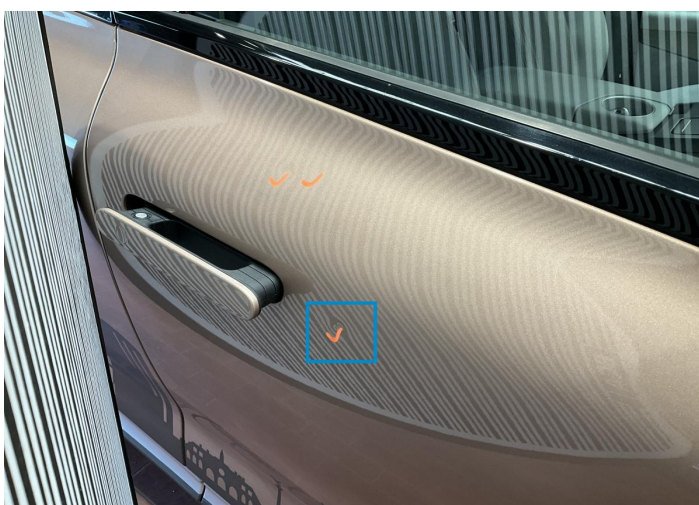

11. Door / Front Right
Bodywork / Dent / Dent -



12. Bumper / Back
Paint / Scratch / Scuff -

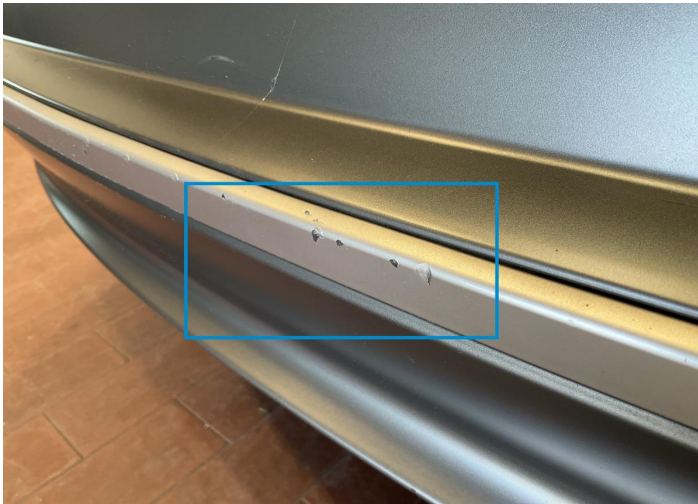

13. Bumper / Back
Paint / Scratch / Scuff -



14. Door / Back Left
Paint / Scratch / Scuff -



15. Interior door handle Back right
Interior / Scraped -

Mechanical Condition

Control Lights

Display Defect	✓	ABS Warning Light	✓
ESP Fault/Traction Control Malfunction Light	✓	Airbag Warning Light	✓
Oil Pressure Warning Light	✓	Brake Warning Light	✓
Power Steering Warning Light	✓	No Dashboard Lights	✓
Service Light	✓		

Equipments Test

Central Locking	✓	Electric Windows	✓
Navigation System	✓	Audio Equipment	✓
Parking Sensors / Cameras Functioning	✓	AC / Heating System	✓

Engine

Engine Status / EML	✓	Engine Starts	✓
---------------------	---	---------------	---

Levels

Brakes Fluid	✓
--------------	---

Test Drive Inspection

Steering Wheel

Steering Noise / Anomaly	✓
----------------------------	---

Brake

Brake System Anomaly	✓
----------------------	---

Engine

Engine Noise	✓
--------------	---

General

Test Driven Status	Not Performed
--------------------	---------------

✓ **No troubles detected, good condition or correct tests, according to vehicle age and mileage**

! **Damages or malfunction detected that requires repairs by the buyer**

NA **Not applicable**

☐ **Not tested**

Disclaimer

Please also note the "UserGuide condition report", which shows the scope of the vehicle description.

[User Guide](#)