



PEUGEOT Rifter: 1XEC134

Vinnnummer:	VR3ECYHZRKJ755368	Versionname:	Rifter 1.5 BlueHdi 130 EAT8 S/S GT Line Long
First Registrationdate:	3/12/2019	Fiscalpower:	96kW/131pk 5D/P Auto-8
Expertise Mileage:	161310	Power Kw:	
Bodytype:		Body colour	Blue
Gearbox:	Automatic	Parking lot	c218
Transmission:	Front	Type of rims (mounted)	Aluminium
Fueltype:	Diesel		
Number of seats	7		
Bodywork	Clean		
Registration Certificate Car (BE)	Yes		
Number of doors	5		
Number head rests	7		
Type of rims (mounted)	Aluminium		
Certificate of Conformity	Yes		
Category	Passenger Car		
Interior	Clean		

Options

GPS storage		Front parking sensors
GPS storage	HD	Radio
Rims alloy		Fog lights (front)
Number of keys total	2	Rear parking sensors
Windows electric F		
Airco electronic		
Steering wheel multifunctional		
Seats F heated		
Navigation with screen		
Number keys remote	2	
Windows electric R		
Cruise Control		

Limited Technical Inspection

Engine startingtime	OK	Sound engine	OK
Idle position	OK	Transmission	OK
Exhaust gass	OK	Clutch test	OK

Degree of wear

215/65/16/98 H				
Winter tyres:	Fr.L.	Goodyear: 6 mm	Fr.R.	Goodyear: 6 mm
	Re.L.	Michelin: 6 mm	Re.R.	Michelin: 6 mm
Tyre size RR				215/65 R 16 98 H
Tyre make RR				261
Tyre profile depth FL				6.0
Tyre type FR				Winter
Tyre size FL				215/65 R 16 98 H
Tyre make FL				259
Tyre profile depth RL				6.0
Tyre type RR				Winter
Tyre make RL				261
Tyre size RL				215/65 R 16 98 H
Tyre type FL				Winter
Tyre profile depth FR				6.0
Tyre type RL				Winter
Tyre make FR				259
Tyre size FR				215/65 R 16 98 H
Tyre profile depth RR				6.0

Assistance equipment

number of charging cables (rapid charge)	0	Jack	Yes
Spare wheel	Yes		
Number of charging cables (normal)	0		
Floor covering FL, Worn, Acceptable			
			
Seat cover FL, Worn, Acceptable			
			
Door panel FL, Scratch(es), Acceptable			
			
Windscreen, Repaired, Acceptable			
			
Bonnet, Stone chip(s), Acceptable			
			
Bumper F, Scratch(es), Acceptable			
			
			
Bumper moulding F, Scratch(es), Acceptable			
			
Alloy rim RL, Scratch(es), Acceptable			
			
Door RL, Bad repair, Repair and paint (complete)			
			
Internal boot lining L, Worn, Acceptable			



Internal boot lining R, Worn, Acceptable



Boot carpet, Worn, Acceptable



Boot lid covering R, Worn, Acceptable



Alloy rim FR, Scratch(es), Acceptable




Alloy rim RR, Scratch(es), Acceptable



Door trim FR, Scratch(es), Acceptable



Wing FR, Scratch(es), Acceptable

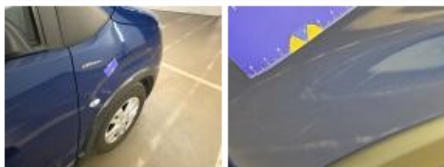

Roof pillar R, Dent(s), Acceptable



Bodywork, Damaged, Check



Roof, Chemical pollution, Polish

